



# EX 11 Installation Guide




Cut cable squarely

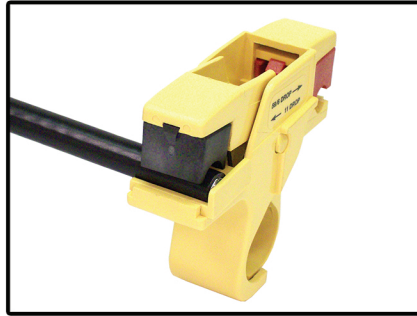


Using a fixed blade prep tool in good condition, prepare cable to 1/4" x 1/4" dimensions

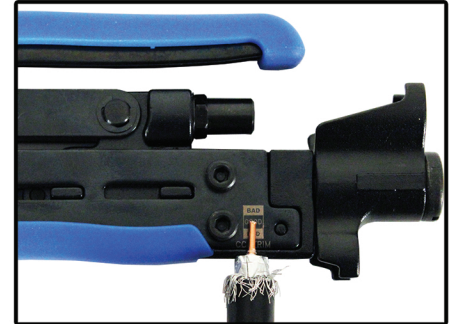


Ensure cable is prepared to 1/4" x 1/4" dimensions

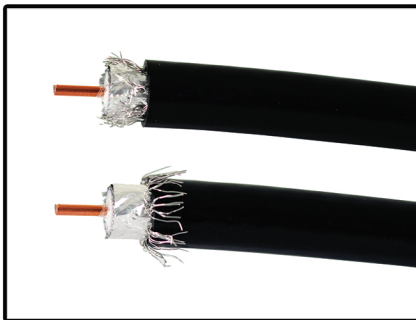


Ensure there is no dielectric, braid or foil wrapped around center conductor. Fold back braid.

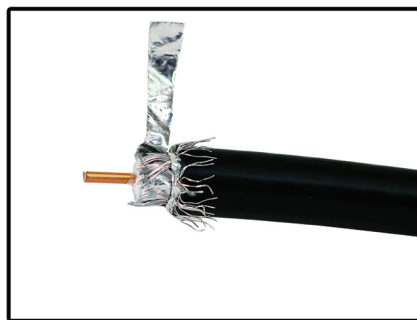


If tri-shield or quad, remove outer layer of foil

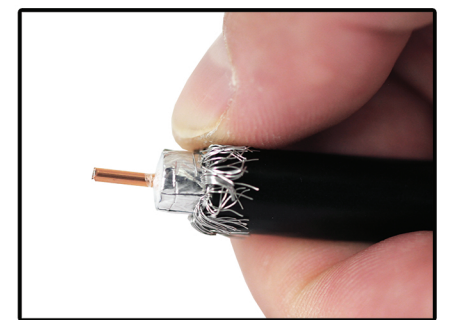


Fold back inner braid

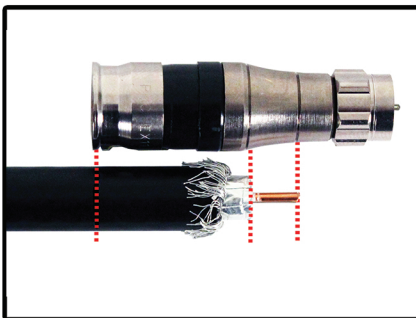


Align center conductor and dielectric with marking grooves on connector body

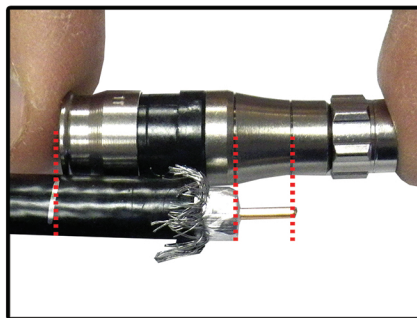

Mark cable at the base of the connector with thumbnail or other marking device

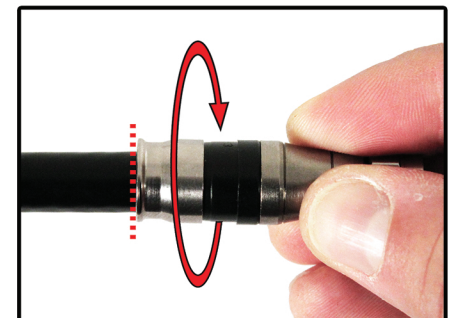

Insert cable into connector push firmly while rotating clockwise until the connector reaches the mark on the jacket.

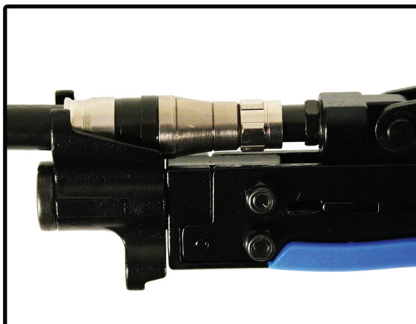

Properly seated connector ready for compression



Visually inspect to ensure connector is fully compressed. Tighten to recommended torque.

## Part Numbers

• EX11N716PLUS



## Description

EX® Universal compression connector for

